

Manhole Inspection Summary

Manhole # S25GG1016MH

Printed On: 12/17/2008

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **25GG1** Node: **016** Status: **Found**

Insp Date: **1/19/07 10:54 AM**

Incomplete Comments

Crew: **CH, JJ**
Inspector: **Hale, C**
Firm: **RKK**

Location Address: **4130 FALLS RD**

Cross Street: **WELDON AVE**

Manhole Type: **Inline** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **4** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick**

☐ Parged Height: **6** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **1.5** (ft.) ☐ Active Surcharge Present

Location View



Top View



Corroded steps. Evidence of surcharge - Bench debris.

Defect



Frame leaks. Adjustment and Barrel infiltration.

Defect



Frame leaks. Frame offset. Adjustment and Barrel infiltration.

Defect



Barrel deterioration and infiltration.

Defect



Heavy Bench debris.

Manhole Inspection Summary


Manhole # S25GG1016MH

Printed On: 12/17/2008

Page 3 of 3

8 in. Circular Gravity Sewer

Pipe Out @ 12 O'Clock

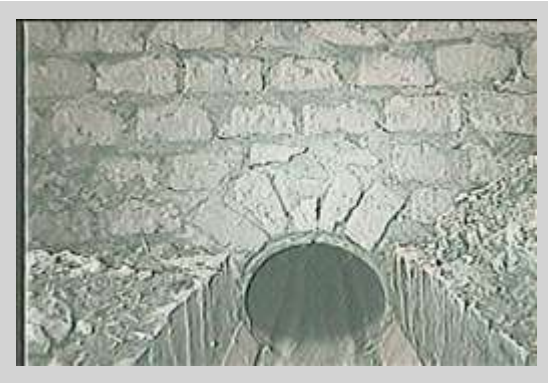

Barrel deterioration and infiltration. Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.41** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.94** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection